


ЗЕНКОВКИ ИЗ БЫСТРОРЕЖУЩЕЙ СТАЛИ

Обозначение	D	l	L	d	$\alpha^\circ$	z
<b>3 580-2,00-60-45-C5</b>	2,00	2,6	45	5,0	60 <sup>0</sup>	2
<b>3 580-2,00-90-45-C5</b>	2,00	1,5	45	5,0	90 <sup>0</sup>	2
<b>3 580-2,00-120-45-C5</b>	2,00	0,9	45	5,0	120 <sup>0</sup>	2
<b>3 580-2,50-60-50-C6,3</b>	2,50	3,3	50	6,3	60 <sup>0</sup>	2
<b>3 580-2,50-90-50-C6,3</b>	2,50	1,9	50	6,3	90 <sup>0</sup>	2
<b>3 580-2,50-120-50-C6,3</b>	2,50	1,1	50	6,3	120 <sup>0</sup>	2
<b>3 580-3,15-60-50-C8</b>	3,15	4,2	50	8,0	60 <sup>0</sup>	2
<b>3 580-3,15-90-50-C8</b>	3,15	2,4	50	8,0	90 <sup>0</sup>	2
<b>3 580-3,15-120-50-C8</b>	3,15	1,4	50	8,0	120 <sup>0</sup>	2
<b>3 580-4,00-60-56-C10</b>	4,00	5,2	56	10,0	60 <sup>0</sup>	2
<b>3 580-4,00-90-56-C10</b>	4,00	3,0	56	10,0	90 <sup>0</sup>	2
<b>3 580-4,00-120-56-C10</b>	4,00	1,7	56	10,0	120 <sup>0</sup>	2
<b>3 580-5,00-60-63-C12,5</b>	5,00	6,5	63	12,5	60 <sup>0</sup>	2
<b>3 580-5,00-90-63-C12,5</b>	5,00	3,7	63	12,5	90 <sup>0</sup>	2
<b>3 580-5,00-120-63-C12,5</b>	5,00	2,2	63	12,5	120 <sup>0</sup>	2
<b>3 580-6,30-60-71-C16</b>	6,30	8,4	71	16,0	60 <sup>0</sup>	2
<b>3 580-6,30-90-71-C16</b>	6,30	4,9	71	16,0	90 <sup>0</sup>	2
<b>3 580-6,30-120-71-C16</b>	6,30	2,8	71	16,0	120 <sup>0</sup>	2

Группа применения

P	M	K	N	S	H
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>

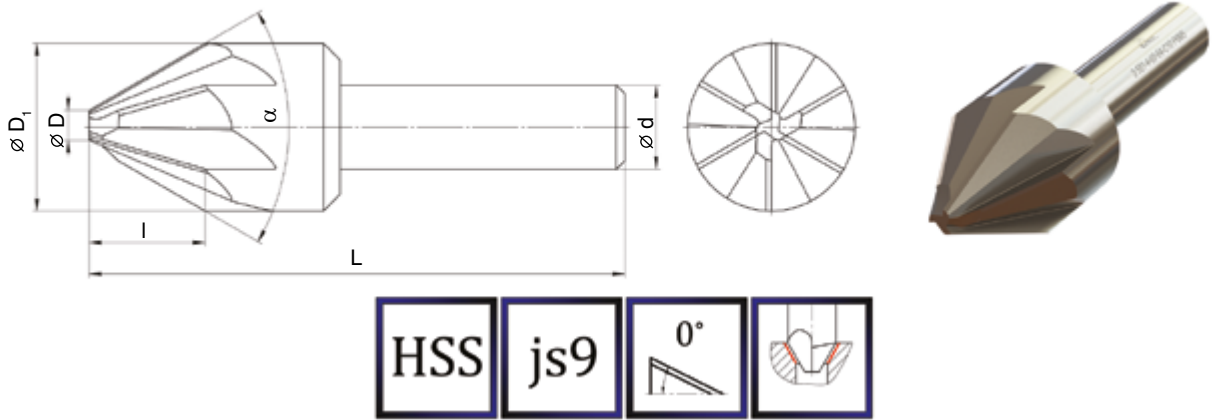

Обозначение	D	D <sub>1</sub>	l	L	d	α°	z
3 581-1,6-60-48-C8	1,6	8,0	5,5	48	8	60°	4
3 581-1,6-90-44-C8	1,6	8,0	3,2	44	8	90°	4
3 581-1,6-120-44-C8	1,6	8,0	1,9	44	8	120°	4
3 581-2,0-60-50-C8	2,0	10,0	6,9	50	8	60°	4
3 581-2,0-90-46-C8	2,0	10,0	4,0	46	8	90°	4
3 581-2,0-120-46-C8	2,0	10,0	2,3	46	8	120°	4
3 581-2,5-60-52-C8	2,5	12,5	8,7	52	8	60°	4
3 581-2,5-90-48-C8	2,5	12,5	5,0	48	8	90°	4
3 581-2,5-120-48-C8	2,5	12,5	2,9	48	8	120°	4
3 581-3,2-60-60-C10	3,2	16,0	11,1	60	10	60°	4
3 581-3,2-90-56-C10	3,2	16,0	6,4	56	10	90°	4
3 581-3,2-120-56-C10	3,2	16,0	3,7	56	10	120°	4
3 581-4,0-60-64-C10	4,0	20,0	13,9	64	10	60°	6
3 581-4,0-90-60-C10	4,0	20,0	8,0	60	10	90°	6
3 581-4,0-120-60-C10	4,0	20,0	4,6	60	10	120°	6

Группа применения

P	M	K	N	S	H
<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>

